


4.2 - Novabrik Installation

3- 45° outside corner block

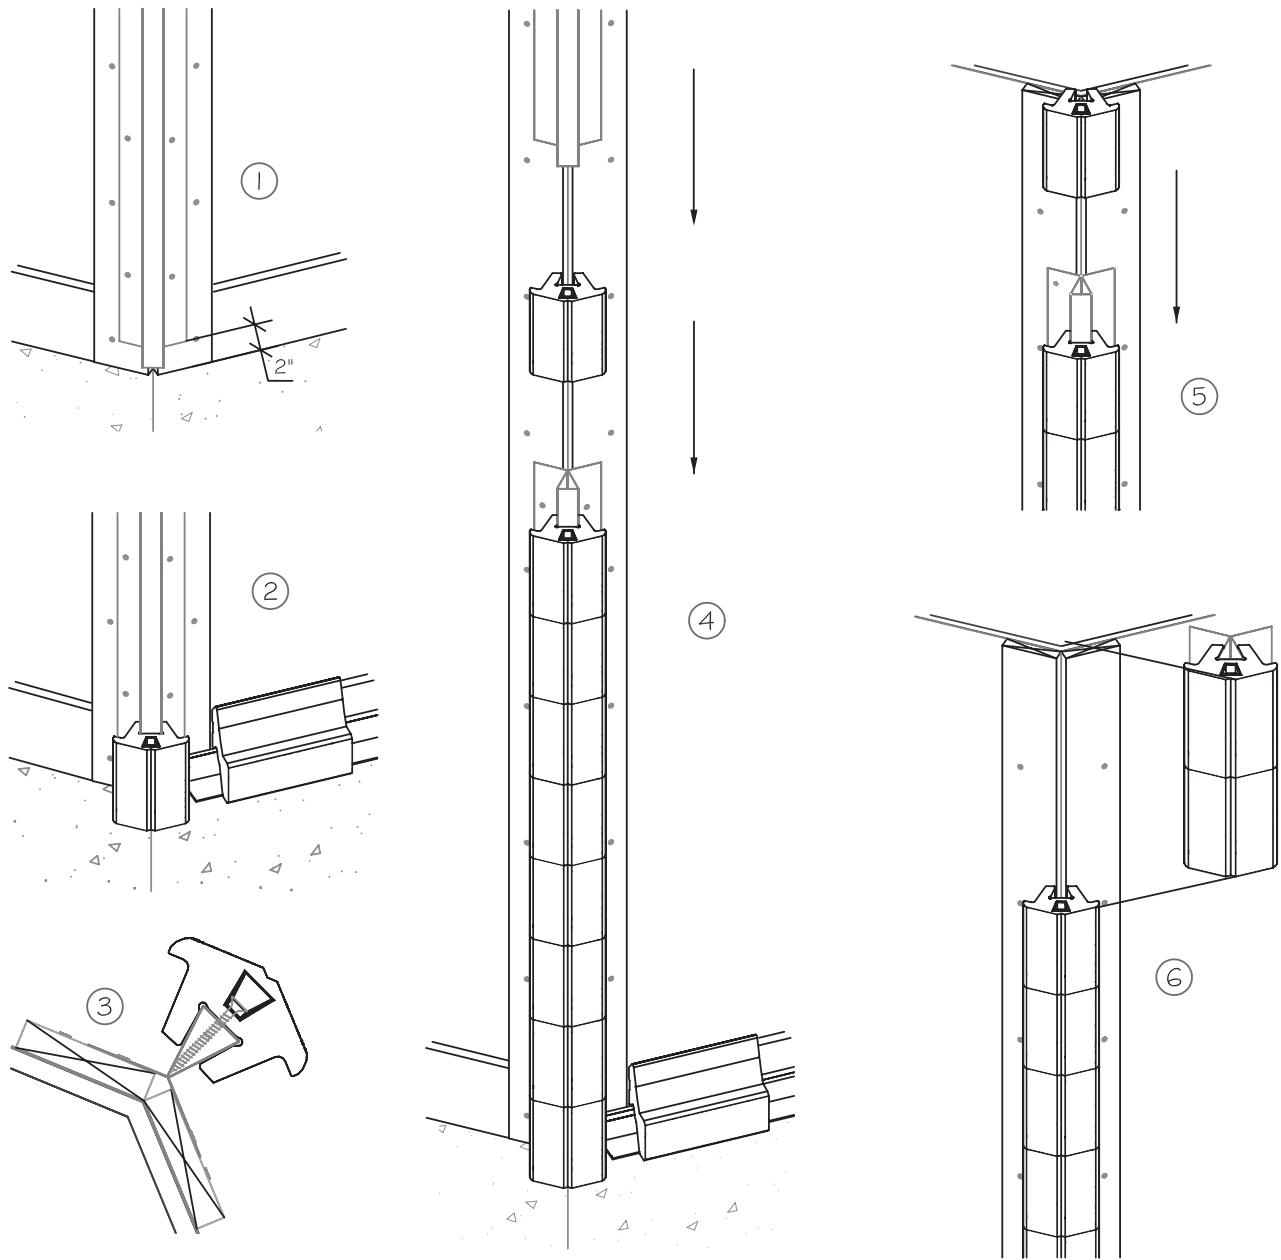

**LEGEND:**

- 1- Install 1" x 4" (19mm x 89mm) furring strips over the corner and fasten the steel corner strip 2" (51mm) from the base with self-tapping corrosion resistant screws at 10" (254mm) o.c.
- 2- Slide down the first block and align with the first course of novabrik.
- 3- Fasten into corner strip with one self-tapping corrosion resistant screw.
- 4- Apply construction adhesive between blocks. Install blocks the same way up to the end of the first corner strip, insert another corner strip and continue.
- 5- Continue up the wall to the end of the last length corner strip.
- 6- Cut corner strip to fit. Fasten the number of blocks required to the corner strip. Cut the last block to fit and secure with construction adhesive. Fasten assembly to wall.

